Practical Tips

Ontinental CONTITECH

ContiTech Experts Provide Timing Belt Replacement Tips

Detailed instructions for the 2.0 I common rail engine in the VW Scirocco, Golf V, Golf VI, Golf Plus and Jetta III • From model year 2008 onwards • Engine code CBDB • ContiTech is demonstrating how mistakes can be prevented when changing belts

Hanover, February 2011. Large numbers of the 2.0 I common rail engine with the engine code CBDB are installed in various VW models. When the timing belt is changed, serious mistakes are often made. To ensure that changing the belts goes smoothly, ContiTech Power Transmission Group is providing mechanics with detailed installation tips. Step by step, the ContiTech expert explains how to replace belts correctly.

The manufacturer recommends that the timing belt and tension pulley be replaced as follows:

Scirocco:	2009 and older: every 180,000 km
	2010 and newer: timing belt and tension pulley every
	210,000 km
Golf Plus:	Timing belt every 180,000 km
Golf V:	Timing belt every 180,000 km
Golf VI:	Timing belt and tension pulley every 210,000 km
Jetta III:	2009 and older: every 180,000 km, tension roller every
	360,000 km
	2010 and newer: timing belt and tension pulley every
	210,000 km

The working time is 2.20 hours for all engines.

Tip: When the timing belt is changed, the tension pulley, the idler pulley and the water pump should be replaced, too.

- 2 -

Fitters require the following special tools for belt changing:

- 1. Locking pin for camshaft (OE 3359)
- 2. Locking pin for high-pressure pump gear (OE 3359)
- 3. Arrester (OE T 10172, OE T 10172/4)
- 4. Lock ring tool for crankshaft (OE T 10050)
- 5. Cap wrench (OE T 10264)
- 6. Locking tool (OE T 10265)

Safety notes:

Turn the engine in the direction of engine rotation ONLY on the crankshaft gear. The crankshaft sprocket and camshaft sprocket <u>must never be</u> <u>rotated</u> after the timing belt has been removed.

Do not use camshaft locking tool(s) as an arrester when loosening or tightening the camshaft gear.

When turning the camshaft, the crankshaft may not be positioned at top dead center (OT).

The timing belt may not come in contact with oil or cooling water.

Adjustment work on the timing belt may be carried out only when the engine is cold.

Make a note of the radio code. Disconnect the battery's negative terminal. We recommend that, once the timing belt has been removed, it always be replaced and not reused.

Tightening torques:

Note: Self-locking nuts and bolts should always be replaced, even if not always specified by the manufacturer.

According to VW, the following nuts and bolts are to be replaced: Bolt(s) on the camshaft gear (tightening torque central bolt: 100 Nm, gear level 1: 20 Nm, gear level 2: 90°) Bolt(s) on the high-pressure pump gear (level 1: 20 Nm, level 2: 90°) Nut(s) of the tension pulley (level 1: 20 Nm, level 2: 45°)

Center timing belt guard (10 Nm)

- 3 -

Lower timing belt guard (10 Nm) Bolt(s) on the vibration damper (level 1: 10 Nm, level 2: 90°) Idler pulley (50 Nm and turn an additional 90°).

Removal:

Remove engine cover.

Dismantle fuel filter.

Disconnect the plug on the coolant temperature sensor.

Open clip(s). Remove the upper timing belt guard.

Remove front right wheel-house liner.

Remove drive unit belt.

Remove vibration damper.

Remove the lower timing belt guard.

Remove the center timing belt guard.

Remove coolant pipe(s).

Position the engine at top dead center cylinder 1. Note the marking(s) (fig.

1, no. 1 and fig. 2, nos. 2 and 3). The geared segment on the timing belt

gear of the camshaft must be at the top (fig. 1, no. 1).

Use lock ring tool for crankshaft (OE T 10050) (fig. 2, no. 1).

Markings of the crankshaft and the lock ring tool for crankshaft must align (fig. 2, nos. 2 and 3).

Lock ring tool for crankshaft: Pins must be positioned flush in the bore hole. Use locking pins on the high-pressure pump gear and on the camshaft (fig. 3, no. 1 and fig. 4, no. 1).

Loosen the bolts on the high-pressure pump gear (fig. 3, no. 2)

Loosen the bolts on the camshaft gear (fig. 4, no. 2)

Use arrester.

Loosen the nut of the tension pulley (fig. 5, no. 1 and fig. 6, no. 1). Using the hex key, turn the eccentric of the tension roller (fig. 5, no. 3 and fig. 6, no. 2) counterclockwise, until the tension roller can be disconnected with the special tool (fig. 5, no. 2). Cap wrench (OE T 10264).

- 4 -

Locking tool (OE T 10265)

Using the hex key, turn the tension pulley clockwise (max. load stop, fig. 6, no. 2).

Tighten the nut of the tension pulley slightly (fig. 5, no. 1 and fig. 6, no. 1). Remove the timing belt from the idler pulley first and then from the gear wheels.

Installation:

Adjustment work on the timing belt may be carried out only when the engine is cold.

Tension pulley: The nose of the base plate must be in the recess (fig. 7, no. 1).

Check the top dead center marking and readjust as required.

The tension pulley must be locked using the locking tool and fixed to the

stop on the right (fig. 6, no. 2).

Turn the camshaft gear clockwise to the stop.

Turn the injection pump gear clockwise to the stop.

Position the timing belt onto the crankshaft, tension pulley, camshaft gear,

coolant pump, and high-pressure pump, in that order.

Loosen the nut of the tension pulley.

Remove special tool (locking tool).

Ensure that the tension roller is positioned correctly.

Using the hex key, turn the tension pulley clockwise (in the direction of the arrow).

The pointer of the tension pulley must be flush with the recess in the base plate (fig. 8, no. 1).

The nut of the tension pulley may not turn while this is being done (fig. 8, no. 2).

Tighten the nut of the tension pulley (fig. 8, no. 2).

Hold the camshaft gear to maintain pretension counterclockwise (use the arrester).

Tighten the bolt(s) on the camshaft gear (fig. 4, no. 2)

Tighten the bolt(s) on the high-pressure pump gear (fig. 3, no. 2)

- 5 -

Remove locking pins on the high-pressure pump gear and on the camshaft pulley (fig. 3, no. 1 and fig. 4, no. 1). Remove crankshaft lock ring tool (Fig. 2, No. 1)

Rotate the crankshaft twice in the direction of engine rotation. Position the crankshaft right before the TDC of the first cylinder (fig. 6). Use lock ring tool for crankshaft (OE T 10050) (fig. 6, no. 1). Turn crankshaft until the lock ring tool can be used. The pin on the crankshaft lock ring tool must be directly in front of the bore hole of the sealing flange (fig. 6, no. 1). Turn crankshaft until the lock ring tool can be used (fig. 6).

Check whether the camshaft can be locked with the lock ring tool.

The pointer of the tension pulley must be flush with the recess in the base plate.

Tighten bolt(s) on the camshaft gear.

Tighten bolt(s) on the injection pump gear.

The rest of the installation procedure takes place as for the disassembly

procedure but in the reverse order.

Mount the drive unit belt.

Decode the radio, program the volatile memory.

Start the engine and check for proper function.

Read error memory. Carry out a test drive.

Document timing belt change.

- 6 -

With annual sales of more than €25.5 billion for 2010, Continental is among the leading automotive suppliers worldwide. As a supplier of brake systems, systems and components for powertrains and chassis, instrumentation, infotainment solutions, vehicle electronics, tires and technical elastomers, Continental contributes to enhanced driving safety and global climate protection. Continental is also a competent partner in networked automobile communication. Continental currently employs approximately 149,000 in 46 countries.

The ContiTech division holds a global market leadership position for many non-tire rubber products and is a specialist in plastics technology in the non-tire rubber sector. The division develops and produces functional parts, components and systems for the automotive industry and other important industries. The division has a workforce of approximately 25,000 employees. In 2009, it achieved sales of approximately €2.4 billion.

Editorial inquiries to

Mario Töpfer Head of Technical Media Relations ContiTech AG Vahrenwalder Strasse 9 D-30165 Hanover, Germany Phone +49 511 938-1304 Fax +49 511 938-1305 mario.toepfer@contitech.de www.contitech.de

Press releases and photos are available on the Web at www.contitech.de/press